

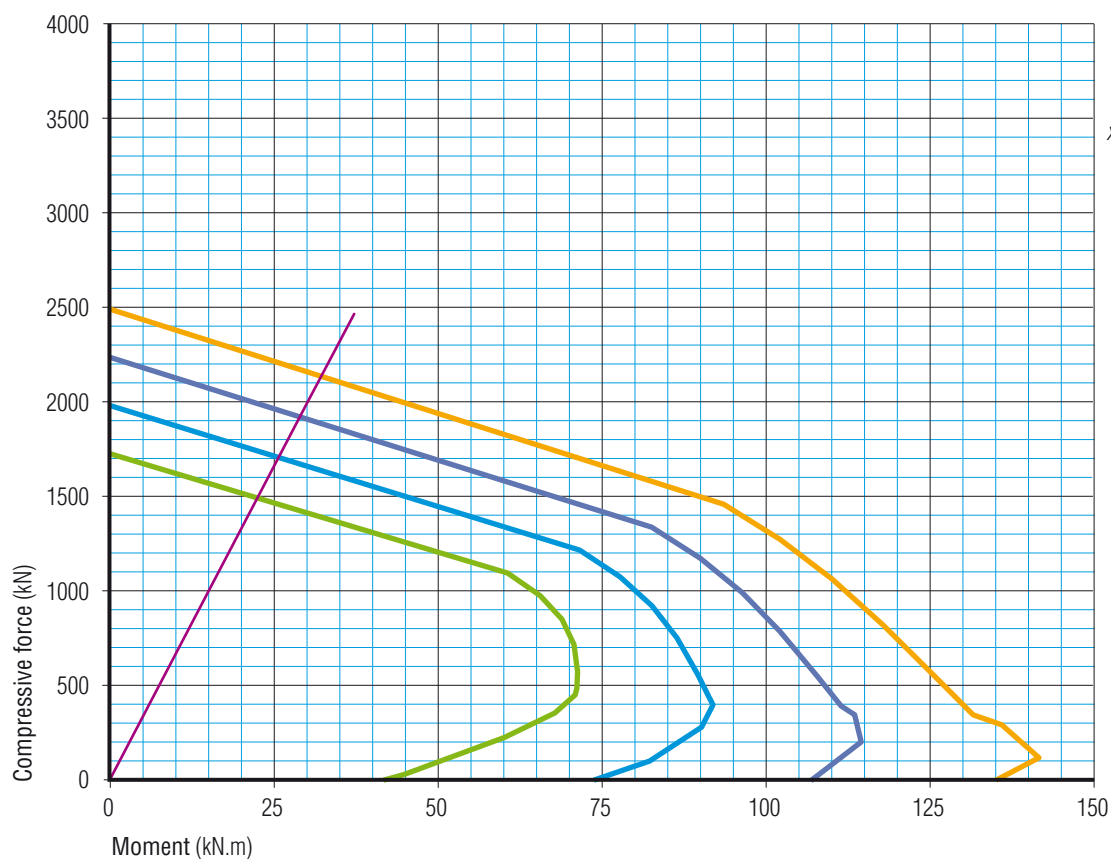
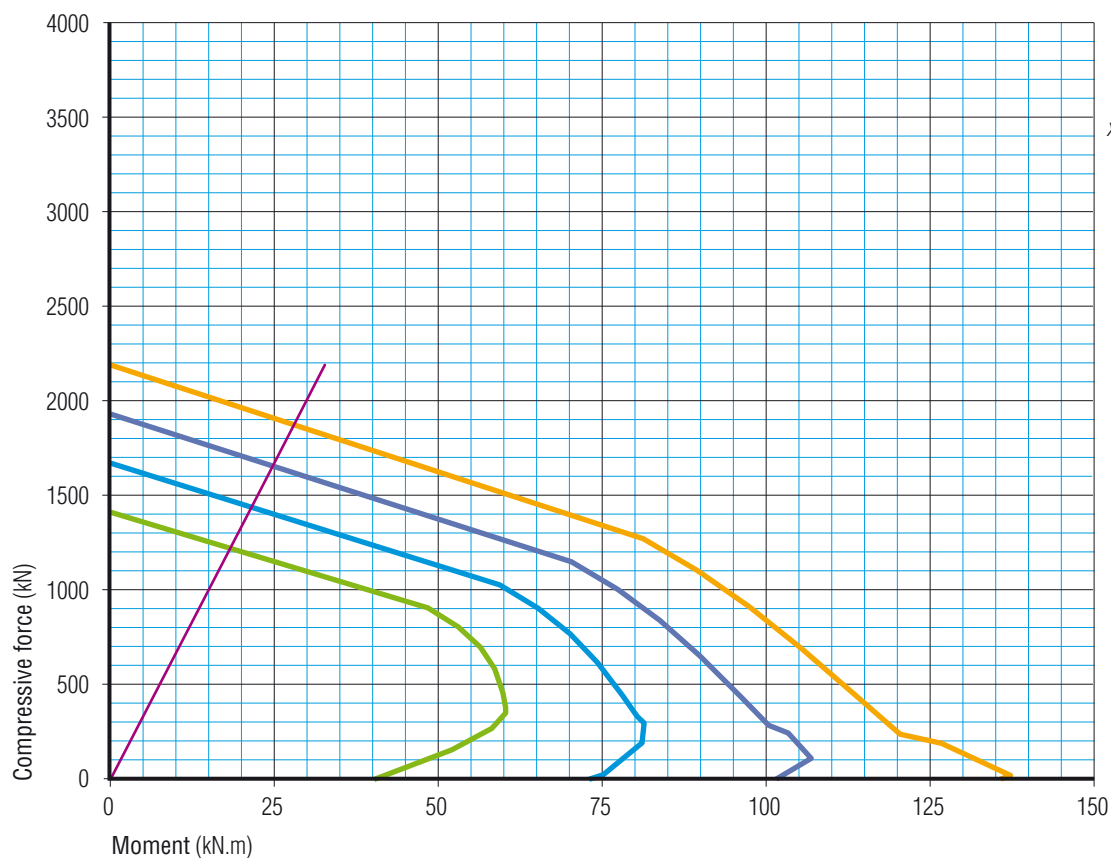




**CHART 6.1** 300 x 300 Columns

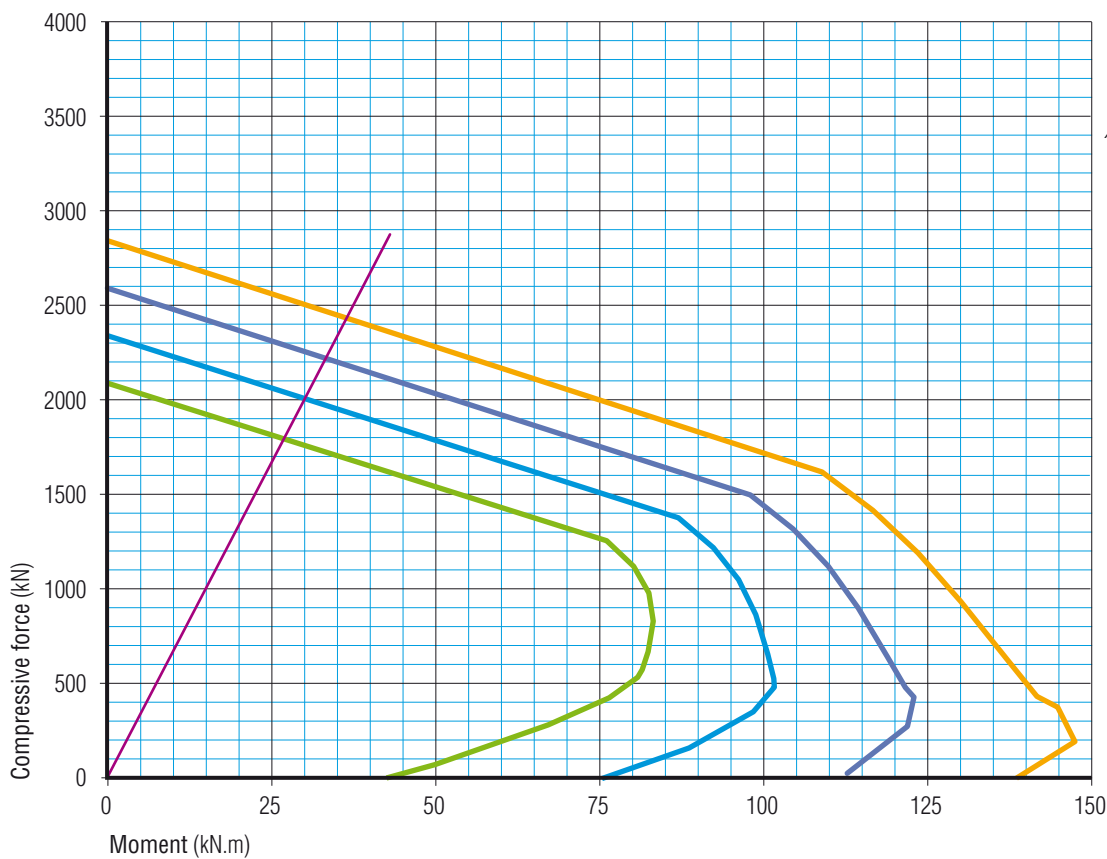



**CHART 6.1 (continued) 300 x 300 Columns**

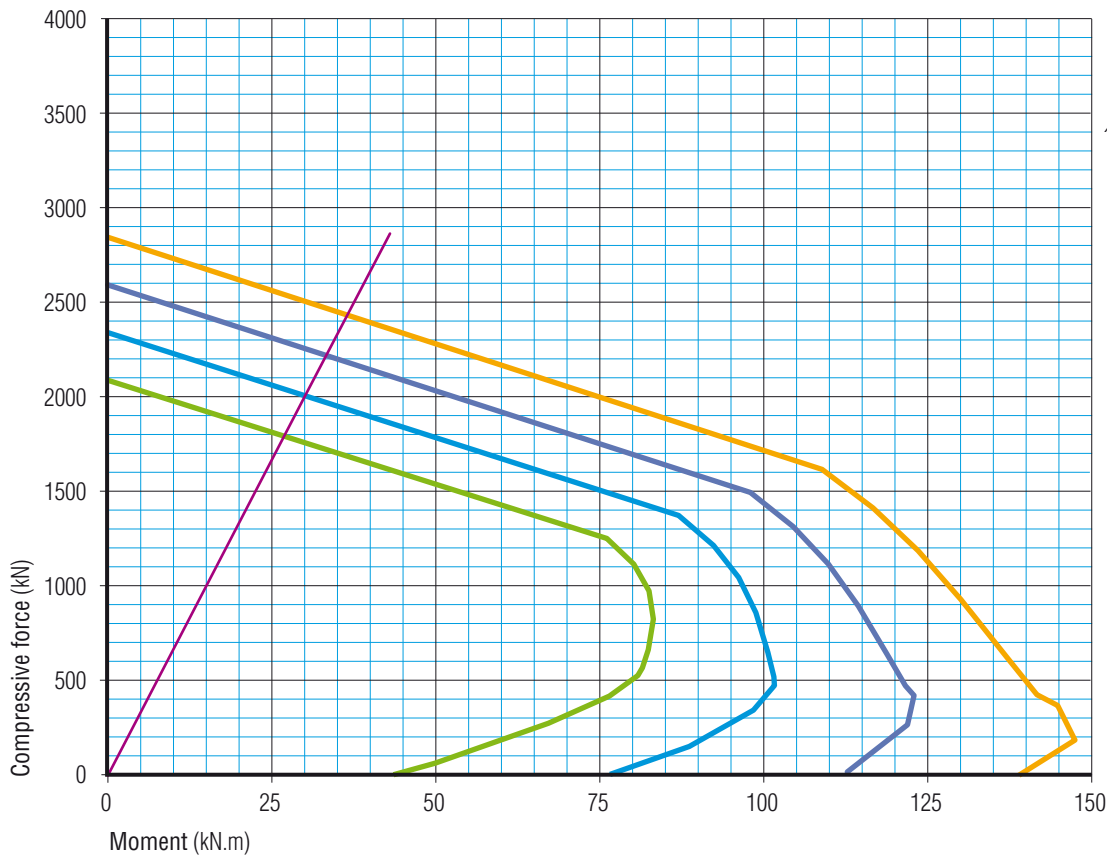



**CHART 6.2** 400 x 400 Columns

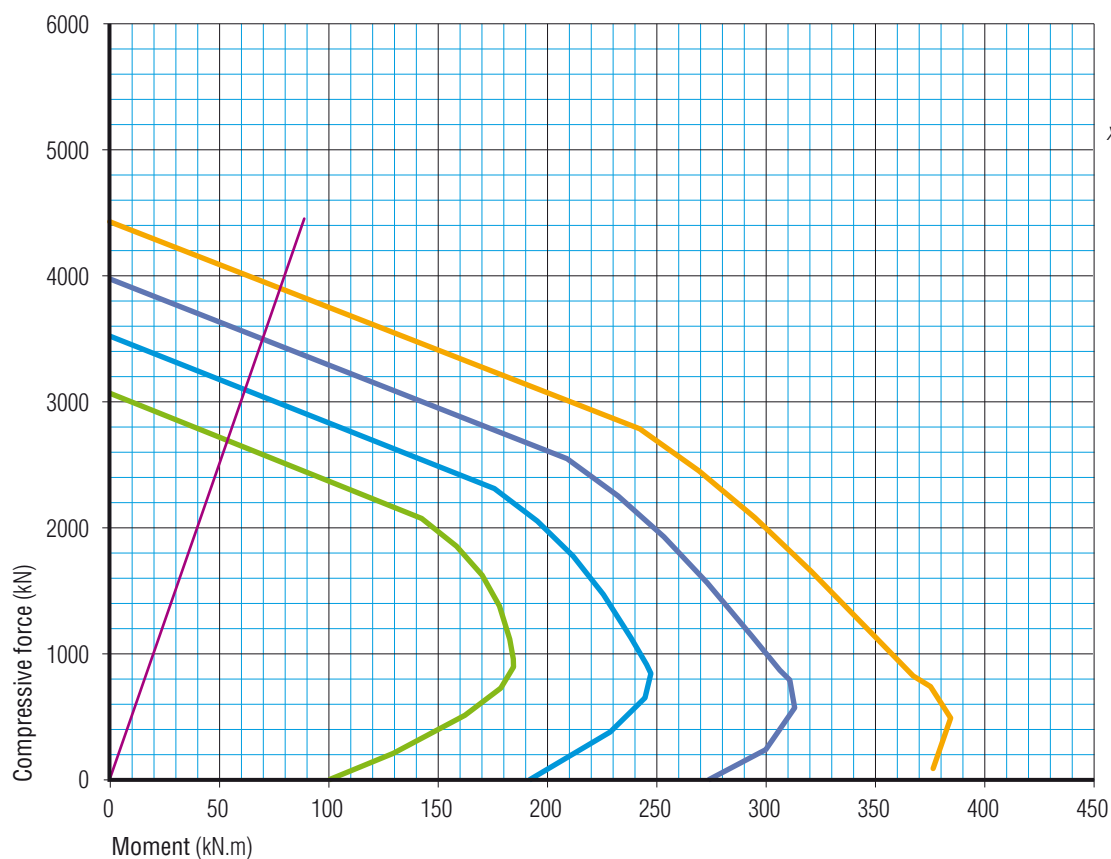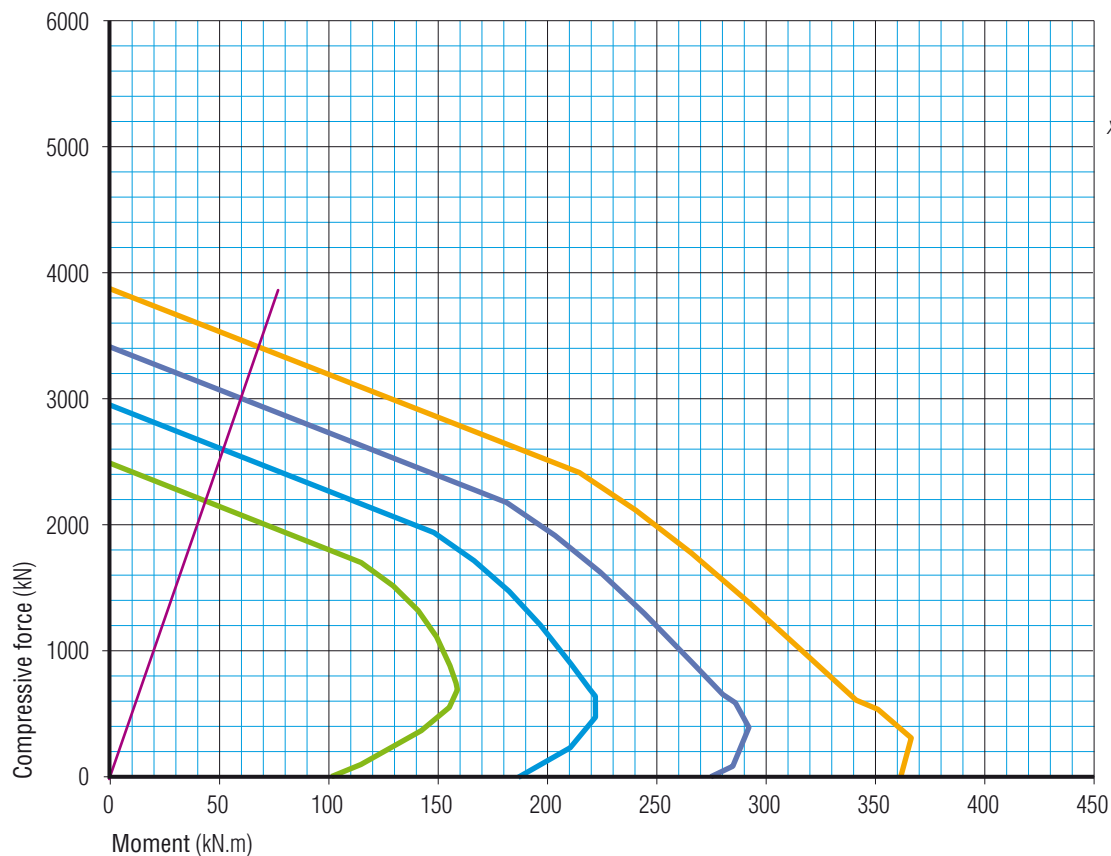



**CHART 6.2 (continued) 400 x 400 Columns**

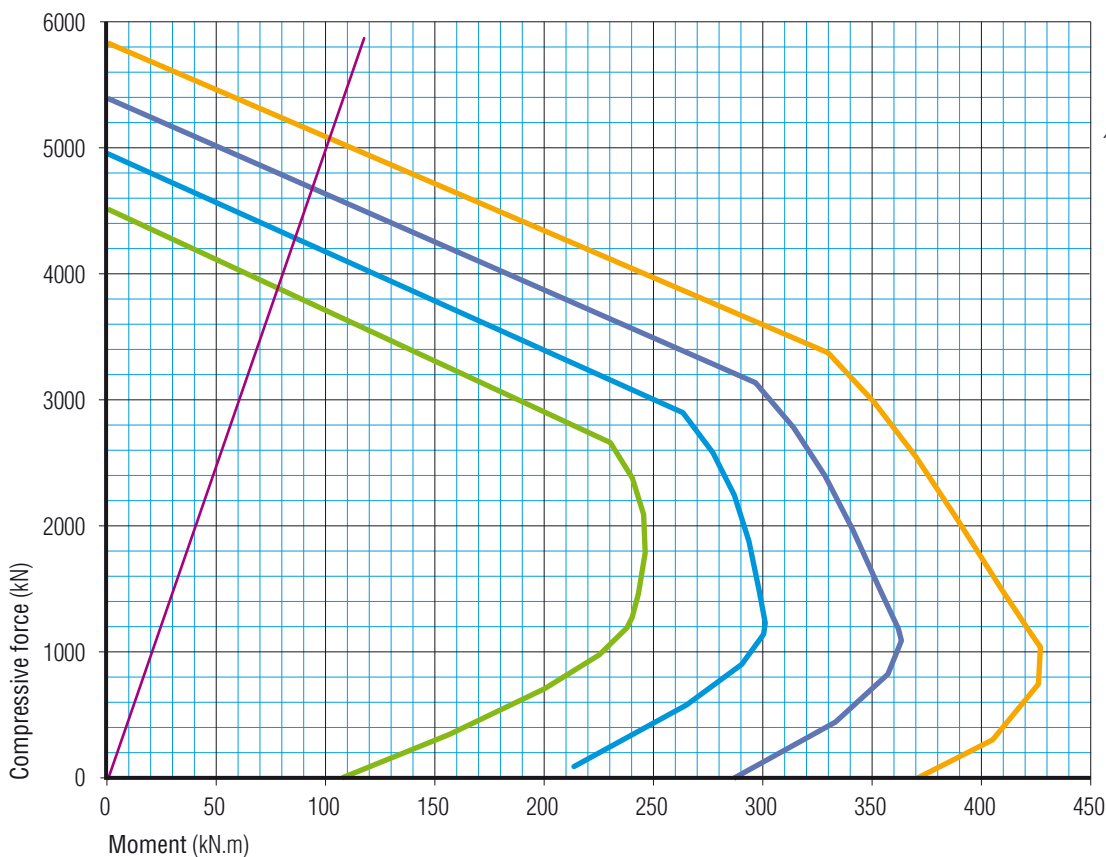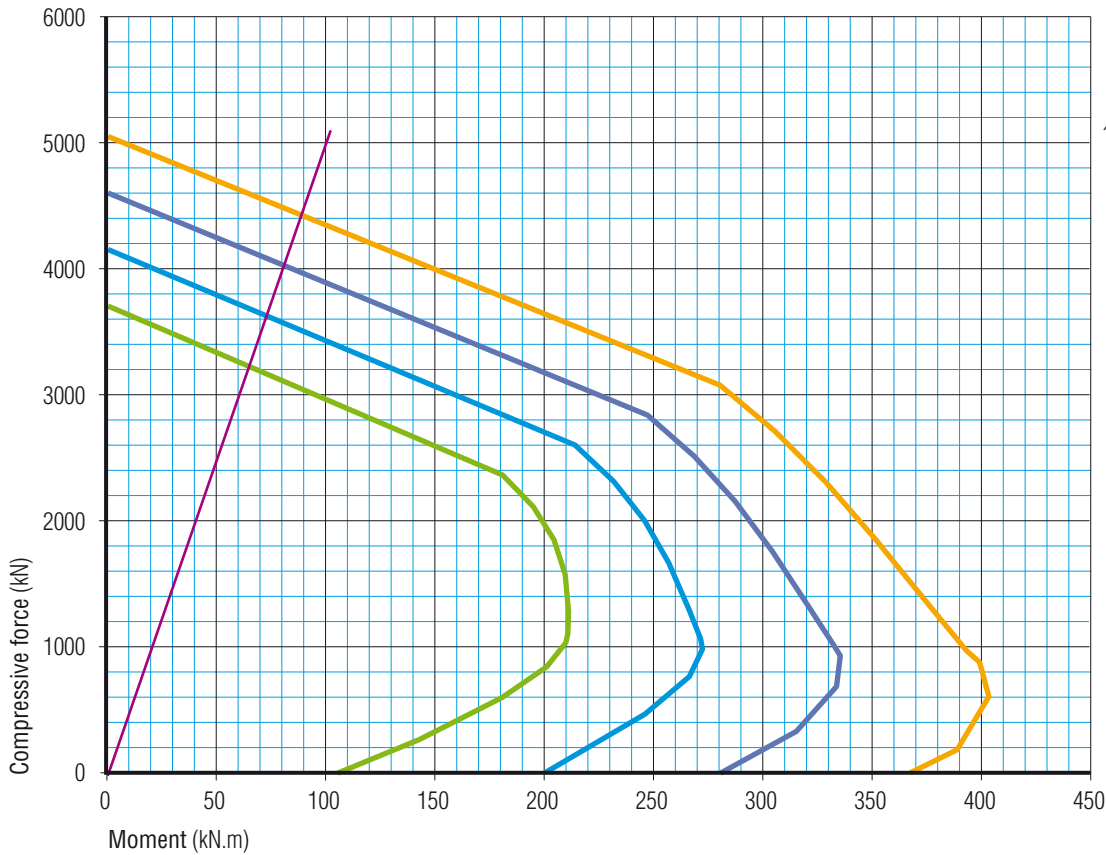

**CHART 6.3** 500 x 500 Columns

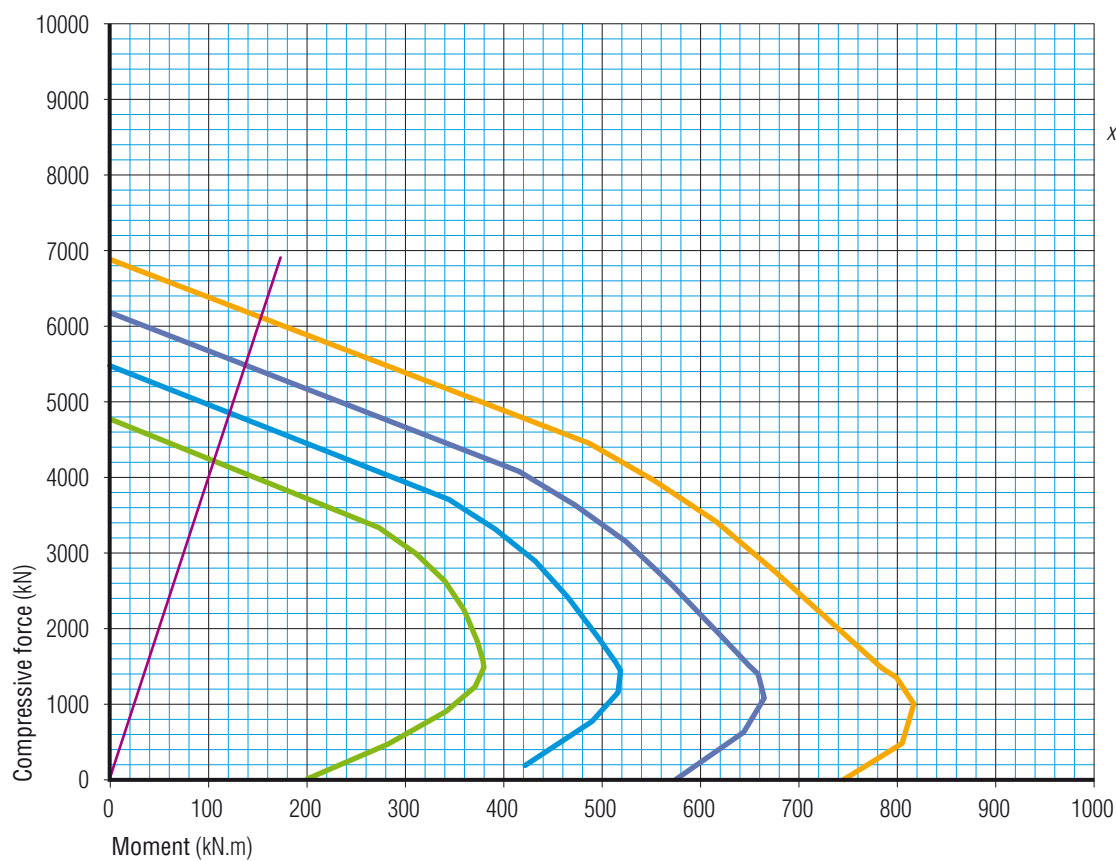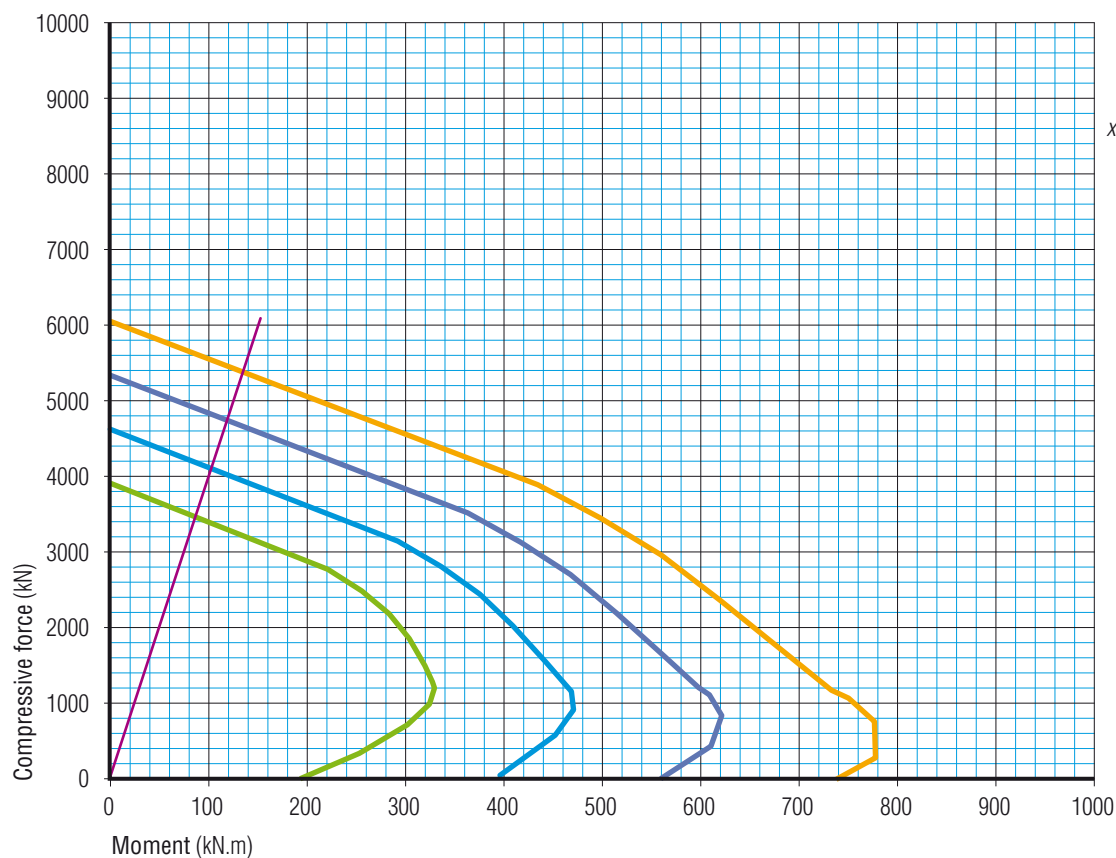




### CHART 6.3 (continued) 500 x 500 Columns

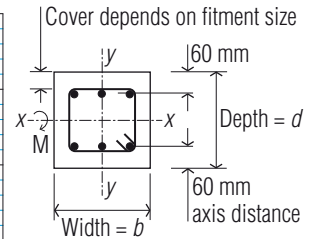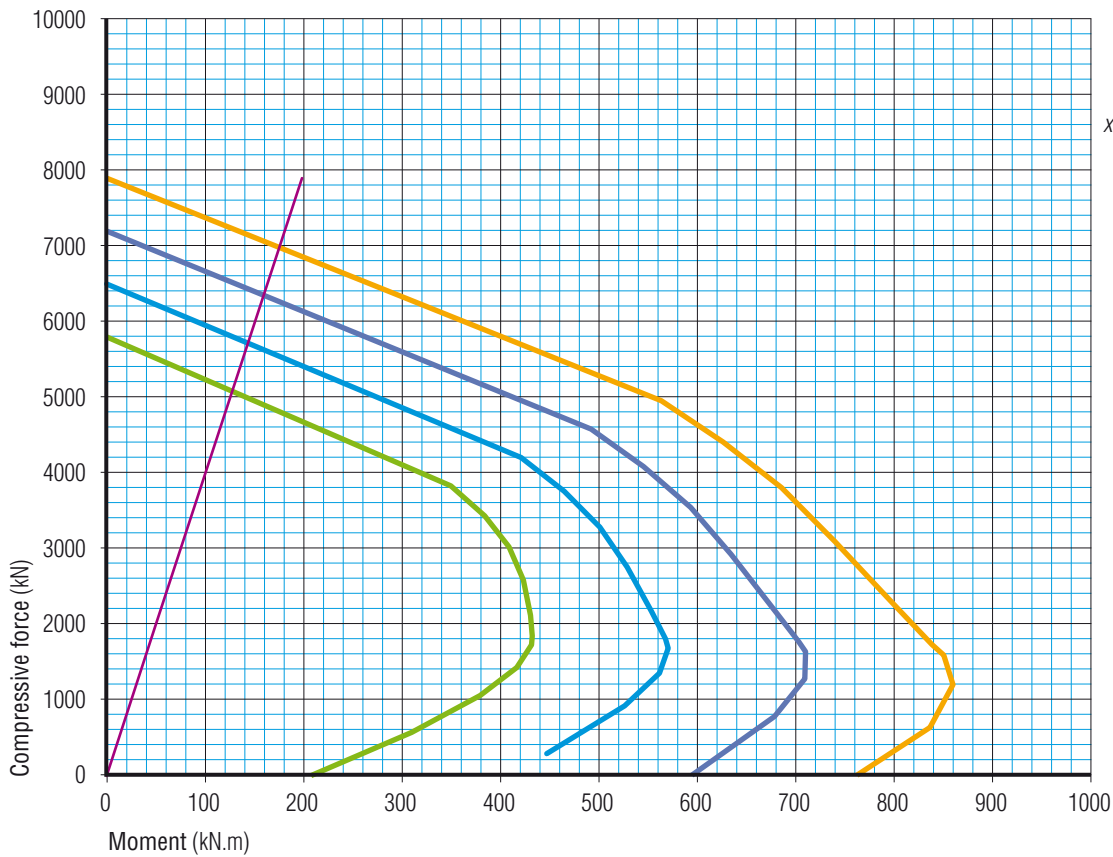

## SQUARE COLUMNS

 $f'_c = 40 \text{ MPa}$ 


- 500 column 1%
- 500 column 2%
- 500 column 3%
- 500 column 4%
- Minimum moment

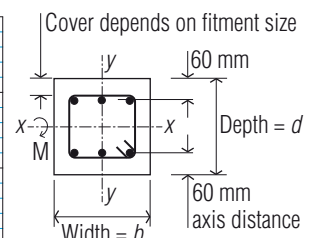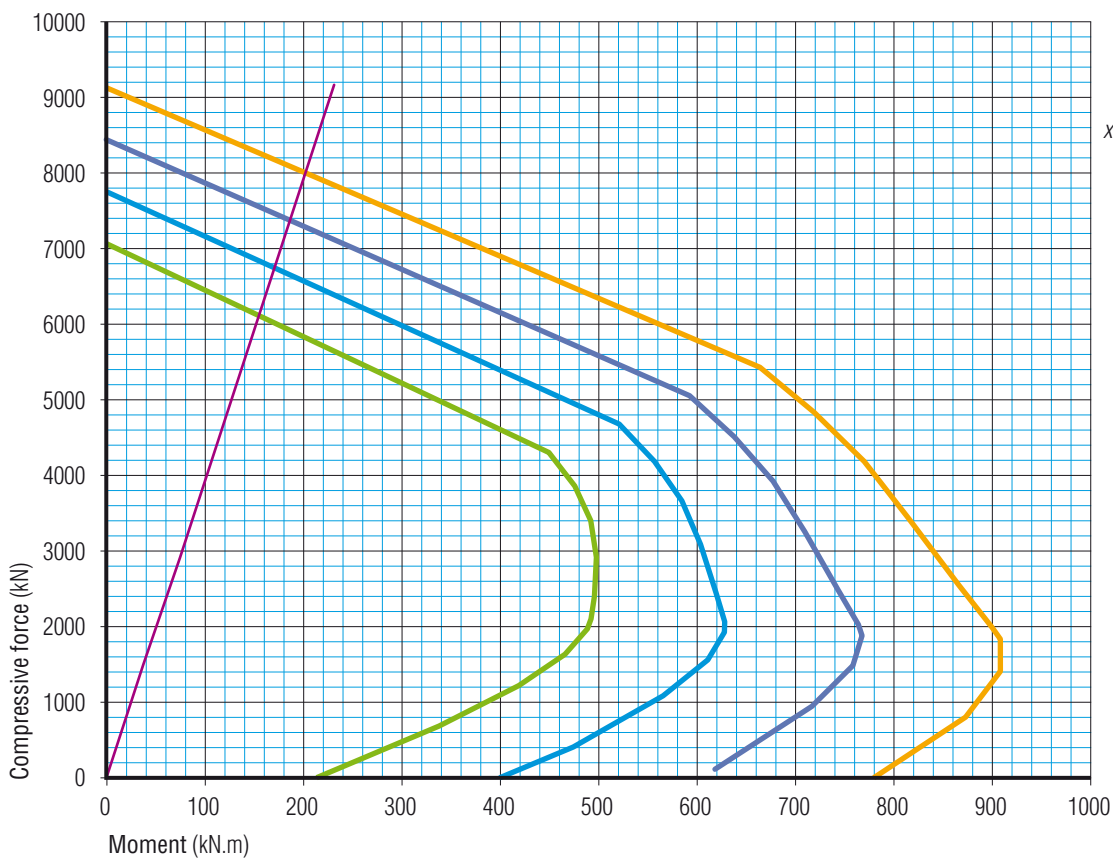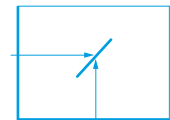


## SQUARE COLUMNS

$$f'_c = 50 \text{ MPa}$$


- 500 column 1%
- 500 column 2%
- 500 column 3%
- 500 column 4%
- Minimum moment

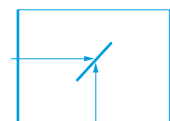

### CHART 6.4 600 x 600 Columns


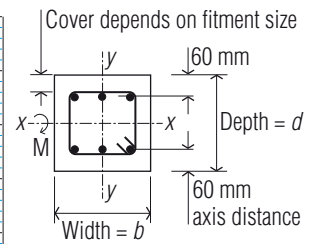
 $f'_c = 25 \text{ MPa}$ 

- 

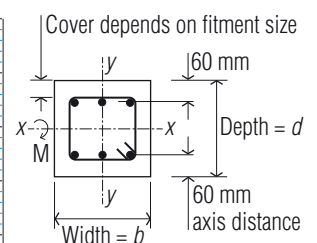
$$f'_c = 32 \text{ MPa}$$



-

**CHART 6.4 (continued) 600 x 600 Columns**

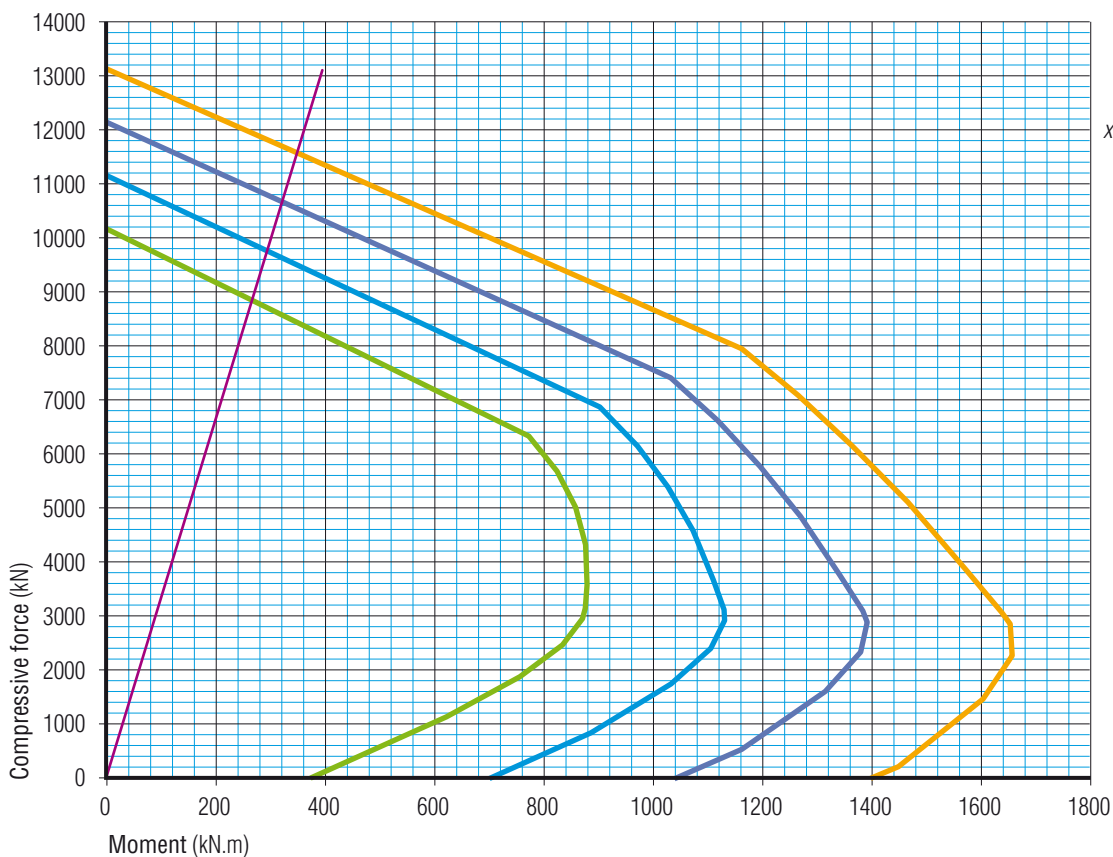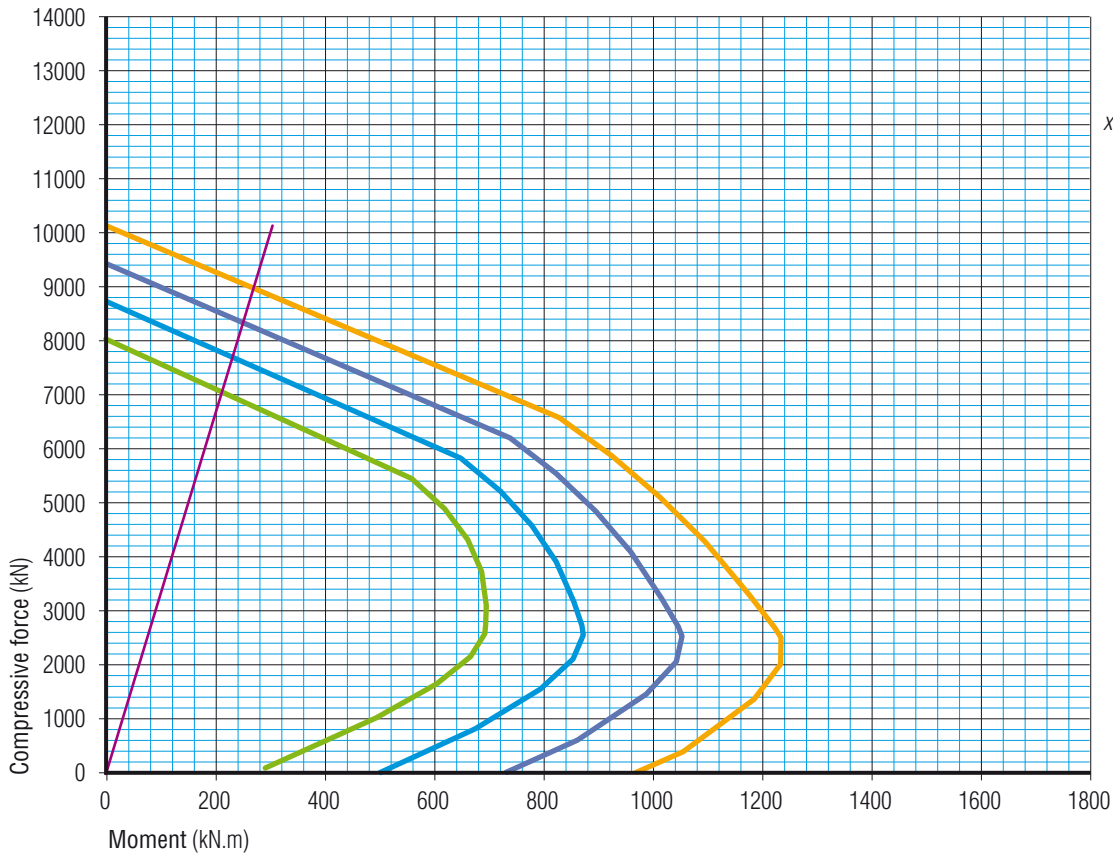



**CHART 6.5** 700 x 700 Columns

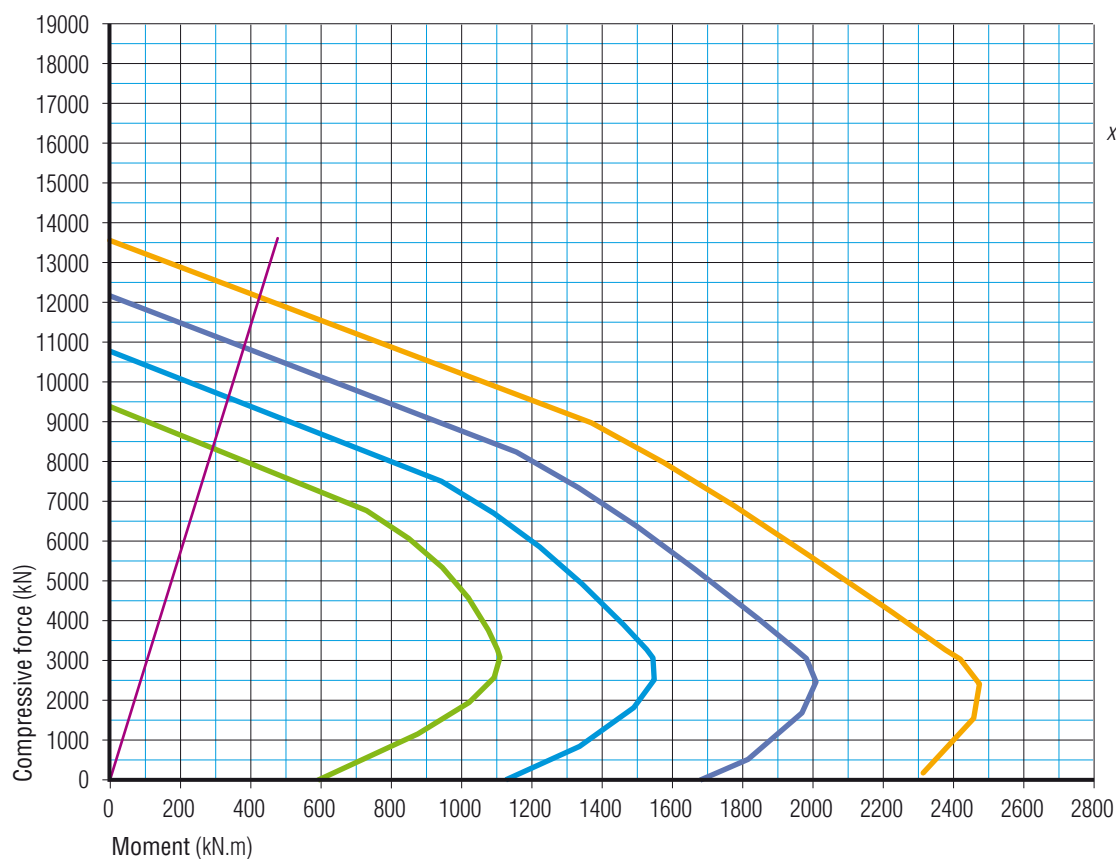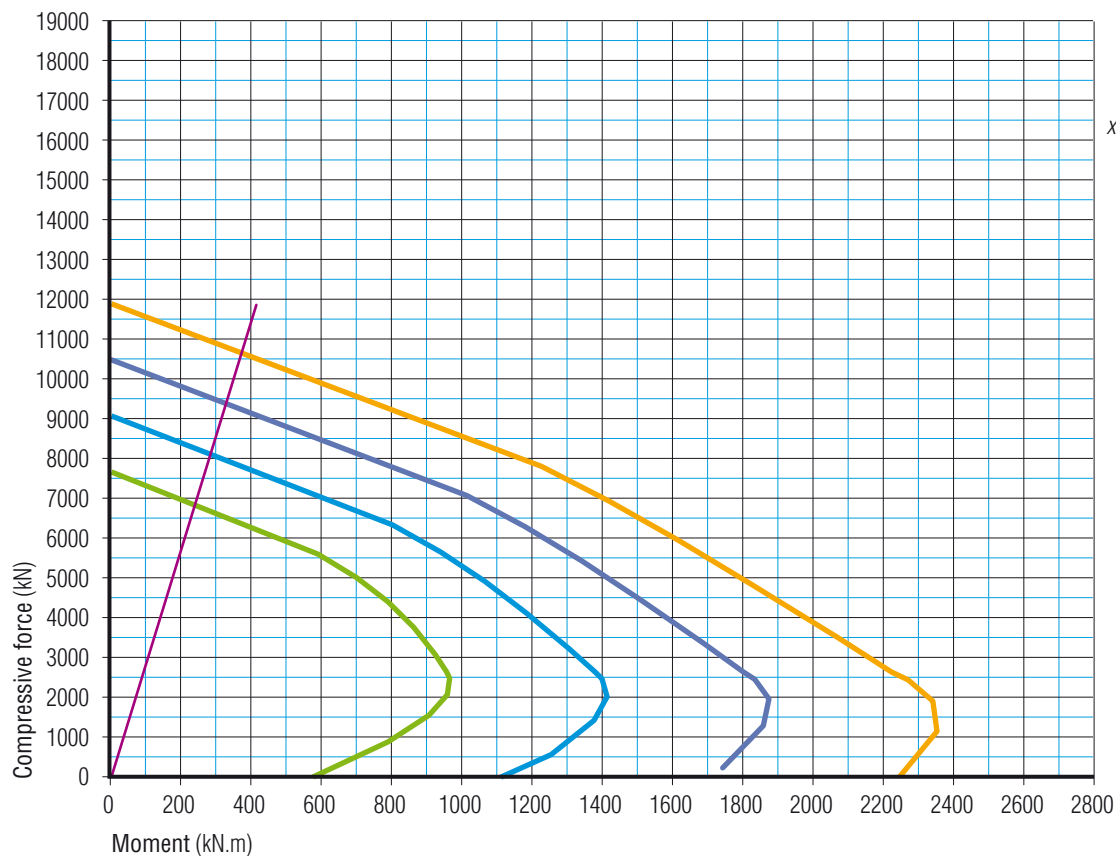

**CHART 6.5 (continued) 700 x 700 Columns**

